

Programed repairs Engine 103 Mechanicals I

Operation no. of work units or standard text and flat rate documentation

01 Oil leaks

Complaint:

Oil escapes at front cover at top

Cause/Remedy:

If there is an oil leak at the front cover at the top, proceed as follows:

Replace front cover (01-2120)

Seal front cover and gap between cylinder ehad gasket and packing with Omni Visc 1050 sealing compound part no. 002 989 45 20, see RA 01-2120.
