

Coordinates

Survey of Items

No.	Item	Coordinates
97-86071	Water enters at rear pillar	G 18
97-88041	With tilting/sliding roof opened, draft from openings of belt guide fitting on center pillar	G 18
97-88121	MB body sealing compound does not cure after application	G 18
97-87011	Water enters at sliding roof	H 18
97-87012	Water enters legroom of front passenger	H 18
97-87092	Water enters driver's/front passenger legroom near front wall pillar	J 18

97 Body sealing

97-86071 Water enters at rear pillar.

Model 124 -
T-sedan

Cause

Seams on hinge recess of tailgate not perfectly sealed.

Remedy

Seal seam with MB body sealing compound, part no. 001 989 63 20, touch up, paint in vehicle color and preserve.

97 Body sealing

97-88041 With tilting/sliding roof opened, draft from openings of belt guide fitting on center pillar.

Cause

Vacuum in vehicle will cause air to flow from outside into vehicle.

Remedy

Set air volume switch at least to blower stage "I".

Glue sealing, part no. 124 690 00 98, approx. 80 mm above upper door hinge, inside, on center pillar.

Production breakpoint: March 1988 phased in.

97 Body sealing

97-88121 MB body sealing compound does not cure after application.

Cause

The tools (brush, wooden spatula etc.) used for the application of MB body sealing compound, part no. 001 989 63 20, were cleaned with paint thinner or other alcohol containing liquids.

Remedy

The tools used for application may only be cleaned with benzine.

97 Leaks

97-87011 Water enters at sliding roof.

Cause

Water drain hoses have insufficient passage, they are kinked.

Remedy

The water drain hoses can be checked for proper routing and water drainage by means of an electric sliding roof control cable in unkinked condition. For this purpose, grind off the projecting contours of the metal piece of the control cable and round off the tip. With exposed access, insert the control cable from the top. If the passage is unobstructed, the control cable should pass easily through the pipe until the tip appears at the water outlet.

97 Leaks

97-87012 Water enters legroom of front passenger.

Cause

Water enters legroom of front passenger at fastening bolts of battery frame.

Remedy

Remove battery and battery frame and slip elastic washer, part no. 115 997 10 40, on fastening bolts. Install battery frame and battery. The washer has been installed during production since end of 10/86.

97 Leaks

97-87092 Water enters driver's/front passenger legroom near front wall pillar.

Cause

Leaking at front wall pillar at break-through of water drain hose for tilting/sliding roof.

Remedy

Seal with MB universal sealing compound, applied from outside by means of a hose end (e.g. from windshield washer). The sealing material is inserted between fender and door. The area is lighted by means of a self-made lamp from a 5 watts tubular lamp and 2 lines.