


40-0331 Checking camber at rear axle

Preceding work:

Checking and adjusting vehicle level at front and rear axles (40-0300).

The rear axle camber results from the vehicle level whereby a corresponding rear wheel camber is assigned to a particular vehicle level (see values for wheel alignment at rear axle).

St+ = Positive camber
St- = Negative camber

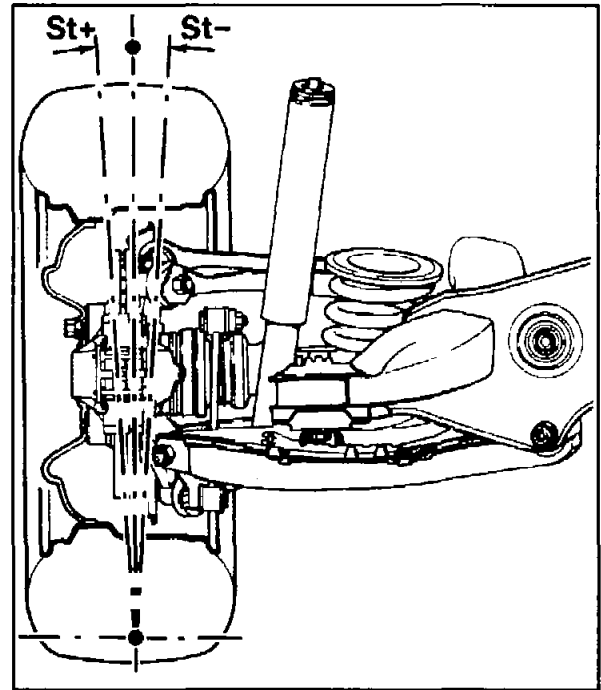

P40-5014-15

Excessive deviations in the rear wheel camber can result from the following causes :

- Difference in level between left and right side of vehicle is too high.
- Camber strut bent.
- Accident damage to frame floor. Differences in level of mounting points for rear axle carrier between left and right side of body.