
Preceding work:

Operation no. of operation texts and work units or standard texts and flat rates: 07-6712

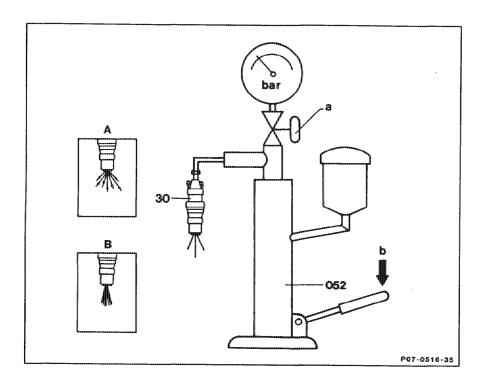

pump 5 times vigorously on
tester (052) 000 589 00 68 00;
close valve "a" for this step.
test; slowly operate hand lever "b" approx.
1 stroke per second for the step.
test. With short, rapid strokes, approx. 2 strokes
per second, the jet must be closed and be
properly formed.
A - Stringy jet "poor"
B - Closed jet "good"
test. Open valve "a" for this step and operate
hand lever "b" slowly (at least 1 stroke per
second).
Specification: 135-145 bar for new nozzles
min. 130 bar for used nozzles.