


Models 124.066 129

- Lower soft top and retract roll bar.


**Model 124.066**

- Remove cover from right side trunk wall.

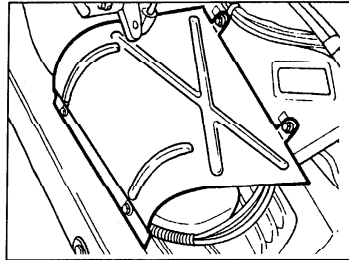

P77-5094-13

- Fluid level should be between max. and min. marks.

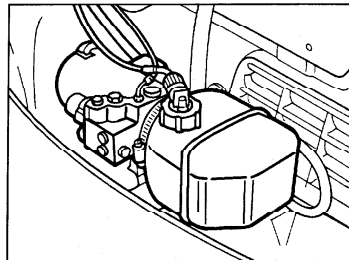


P77-5093-13

# 7710


## Hydraulic top, checking and correcting fluid level

### Model 129


- Remove spare tire.
- Remove cover.

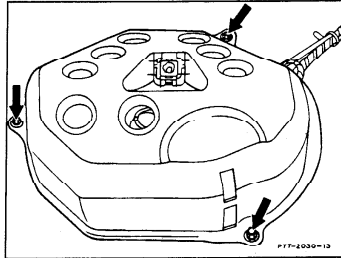

- Starting with chassis end number 029941, the cover has an opening for checking the fluid level (arrow).

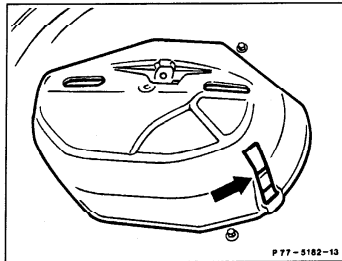

- Fluid level should be between max. and min. marks.

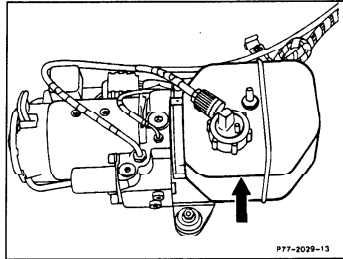

### Oil grade/quantity

Oil grade

MB hydraulic fluid P/N 000 989 91 03  
Refer to MBNA Factory Approved  
Service Products list

Quantity

1.25 liter